

# knitter-switch

## Product-Change Notification


Products affected: DBS 2002, DBS 2003, DBS 2004, DBS 2005, DBS 2006, DBS 2007, DBS 2008, DBS 2009, DBS 2010, DBS 2012, DBS 2102, DBS 2103, DBS 2104, DBS 2105, DBS 2106, DBS 2107, DBS 2108, DBS 2108 F, DBS 2108 SW, DBS 2109, DBS 2110, DBS 2112

Effective date: after current stock is sold out


### Revision of contact parts and case

#### Details:

Soldering with slider in „ON“ position may deform the movable contact and possibly cause reliability problems. Therefore the contact structure was revised:

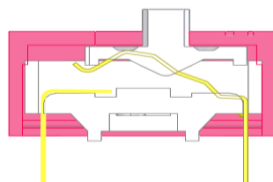

Up to now

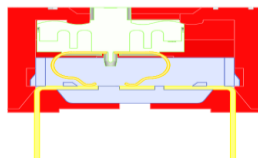

From now on


Further, 4 stand-offs were added to the case edges to improve the alignment of case and PCB.

All electrical spec remains unchanged, as well as case length and width.

The height is now  $(5.85 \pm 0.1)$  mm instead of  $\leq 5.9$  mm.

The slider length of models DBS 21... is now  $(1.2 \pm 0.1)$  mm instead of  $(1.1 \pm 0.1)$  mm.

To distinguish old and new model is very easy by appearance:

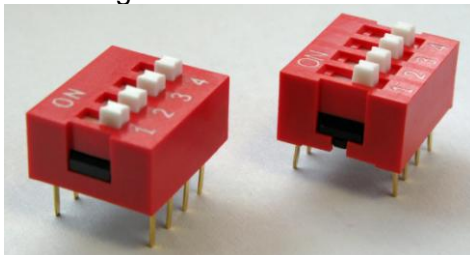

Up to now

From now on

knitter-switch, January 2013

Oliver Kluj  
Technical Director